

		CAO / CZ.CAO.0013 Podlesi 416, 261 01 Příbram Provozovna LKHS, Hosin 253, 37341			AIRCRAFT MAINTENANCE SUMMARY / TIME LIMITED AIRCRAFT PARTS LIST								
AC MANUFACTURER:		Piper	ENGINE MANUFACTURER:		Lycoming			REGISTRATION		ISSUE DATE:		13 February 2026	
AC MODEL:		PA-46-350P	ENGINE MODEL:		TIO-540-AE2A, S/N: L-14278-61A					AIRCRAFT HOBBS:		1027,9	
AC SERIAL NUMBER:		4636698	PROPELLER MANUFACTURER:		Hartzell Propeller Inc.					AIRCRAFT TSN:		1027,90	
PRODUCTION YEAR:		26.08.2016	PROPELLER MODEL:		HC-13Y1R-1N, S/N: NY287B			OK-STN		AIRCRAFT LSN:		N/A	
ATA EVENT DESCRIPTION		REQUIREMENT	LIMIT	LAST PERFORMED	TIME / DATE PART REQUIREMENT BEFORE/AT INSTALLATION			PERFORMED HOURS DATE		NEXT DUE HOURS DATE		REMAINING HOURS DAYS	
AMP TASK NO.	SERIAL NUMBER PART NUMBER	REQUIREMENT DESCRIPTION	FLT (H) CAL (D) LDG (L)	ORGANIZATION LOCATION CRS# / WO#	TSN H / D / L	TSO H / D / L	CT RQM MTH YR	LANDINGS	LANDINGS	LANDINGS	LANDINGS	NOTES REFERENCES	
OWNER / OPERATOR		DOCUMENTS LIMITS											
AD/SB	Airworthiness Directives and Service Bulletins		REVIEW COMPLY AS REQUIRED	- 365 D	CZ.CAO.0013 LKHK 052-25				- 15.10.2025	- 15.10.2026	- 244 D	by CAO	
AMP	Aircraft Maintenance Program MP-PA46-350P-OKSTN-03		REVIEW COMPLY AS REQUIRED	- 365 D	CZ.CAO.0013 LKHS 052-25				- 03.10.2025	- 03.10.2026	- 232 D	CAO approval	
ARC	Airworthiness Review Certificate 6165-3		LIMITATION	- 365 D	CZ.CAO.0013 LKHK 052-25				- 15.10.2025	- 14.10.2026	- 243 D	by CAA	
IC	Insurance Certificate		LIMITATION	- 365 D	- -				- 01.10.2025	- 30.09.2026	- 229 D	by Operator	
ASL	Aircraft Station License 305893/LR		LIMITATION	- 3680 D	- ČTU -				- 19.01.2024	- 31.12.2028	- 1052 D	by ČTU	
POH	Pilot's Operating Handbook VB-2165 REV.8 2-Jul-2024		LIMITATION	- 365 D	CZ.CAO.0013 LKHK 052-25				- 15.10.2025	- 15.10.2026	- 244 D	ACTUAL. REV 8	
CMM / AD / SB / STC		OTHER INSTRUCTIONS FOR CONTINUING AIRWORTHINESS											
AD	2015-19-07 Fuel System - Fuel Injector Lines - Inspection / Replacement Ref. MSB No. 342G		INSPECTION	- 100 H	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H	- 100,0 H	FAA AD 2015-19-07	
AD	2024-21-02 Reciprocating Engine - Connecting Rod Bushing - Inspections / Replacement Ref. MSB 480F		INSPECTION	- 120 D	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 12.02.2026	- EXPIRED	FAA AD 2024-21-02	
SB	SB 1364A Fuel Quantity Capacitance Probe Check		INSPECTION	- 730 D	CZ.145.0059 LKHK				- 943,1 H 01.10.2024	- 01.10.2026	- 230 D	Piper SB 1364A	
SL	SL 1314 - O2 Generator Pin Cap Inspection		INSPECTION	- 100 H	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H	- 100,0 H	Piper SL 1314	
SL	SL 1280 - Rudder Pedal and Bar Assembly Inspection		INSPECTION	- 100 H	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H	- 100,0 H	Piper SL 1280	
SB	SB 1290B - Flap Bracket Inspection, Inboard Bellcrank		INSPECTION	- 100 H	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H	- 100,0 H	Piper SB 1290B	
SL	Piper SL 1286 D Nose landing gear steering components		INSPECTION	- 100 H 365 D	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H 15.10.2026	- 100,0 H 244 D	Piper SL 1286D	
SL	Piper SL 1131 A Aileron sector bearing lubrication requirements		LUBRICATE	- 100 H 365 D	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H 15.10.2026	- 100,0 H 244 D	Piper SL 1131A	
	Airfoil de-icers lubrication		LUBRICATE	- 100 H 365 D	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 1127,9 H 15.10.2026	- 100,0 H 244 D	AMM 12-00-04	
	ELT ME406 Battery replacement 453-6603		REPLACE	- 2190 D	CZ.145.0059 LKHK				- 854,6 H 45114,0 H 0,0 H	- 05.07.2029	- 1238 D	EMM 71-00-00	
	First Aid Kit		INSPECTION	- 365 D	CZ.CAO.0013 LKHK 052-25				- 1027,9 H 15.10.2025	- 15.10.2026	- 244 D	Inspect content and expiration of items	

CAA		National requirements									
	Magnetic compass - SWING	CHECK	-	CZ.145.0059				979,0 H	-	-	CAA-ST-092-n/07
			365 D	LKHK			05.06.2025	On request	-		
			-	-			0	-	-		
	IFR Check (COM/NAV, VOR/LOC/GS, DME, RMI)	CHECK	-	CZ.145.0059				979,0 H	-	-	CAA-ST-092-n/07
			730 D	LKHK			05.06.2025	05.06.2027	477 D		
			-	-			0	-	-		
	Static Pressure System and Altimeters (STBY) Altimeter & Pitotstatic test	TEST CHECK	-	CZ.145.0059				904,3 H	-	-	CAA-ST-092-n/07
			730 D	LKHK			26.04.2024	26.04.2026	72 D		
			-	-			0	-	-		
	ELT Annual check EASA SIB 2019-09	TEST CHECK	-	CZ.CAO.0013				1027,9 H	-	-	EASA SIB 2019-09
			360 D	LKHK			15.10.2025	10.10.2026	239 D		
			-	052-25			-	-	-		
	Transponder(s) TEST HEX ID: 49D3A5 EASA SIB 2011-15	TEST INSPECTION	-	CZ.145.0059				904,3 H	-	-	CAA-ST-092-n/07/EASA SIB 2011-15
			730 D	LKHK			26.04.2024	26.04.2026	72 D		
			-	-			0	-	-		
	Weight & Balance	CHECK	-	Piper				0,0 H	-	-	CAA-ST-092-n/07
			2190 D	KVRB			09.05.2012	08.05.2018	-		
			-	4636539			0	-	-		
CHAPTER 04		Airworthiness limitation									
PA-46-350P	Pressurized Structure	LIFE LIMIT	10145 H	Piper				0,0 H	10145,0 H	9117 H	AMM 04-00
	Fuselage Assembly		-	KVRB			26.08.2016	-	-		
	P/N: 89600-002, -003, -005, -007, -009, -014, -015		-	4636698			0	-	-		
PA-46-350P	Wing, Wing Carry-Through, & their Attaching Structure	LIFE LIMIT	15580 H	Piper				0,0 H	15580,0 H	14552 H	AMM 04-00
			-	KVRB			26.08.2016	-	-		
	Wing Assembly - P/N 89640-010, -012 or 106899-002		-	4636698			0	-	-		
PA-46R-350T	Horizontal Stabilizer	LIFE LIMIT	15580 H	Piper				0,0 H	N/A only for PA-46R-350T		AMM 04-00
			-	KVRB			09.05.2012				
	Horizontal Stabilizer Assembly - P/N 83404-002		-	4636539			0				
PA-46R-350T	Vertical Fin	LIFE LIMIT	15580 H	Piper				0,0 H	N/A only for PA-46R-350T		AMM 04-00
			-	KVRB			09.05.2012				
	Vertical Fin Assembly - P/N 83401-009		-	4636539			0				
PA-46-350P	T.I.T. Probe	LIFE LIMIT	250 H	CZ.145.0059	Performed with FAA US-2011-06-10.			1004,4 H	1254,4 H	227 H	AMM 04-01
			-	LKHK				28.07.2025	-	-	
	P/N 481-389, 481-392, or 686-216 * see AD 2011-06-10		-	-				N/A	-	-	
AMM CHAPTER 05-20		TIME LIMITS / MAINTENANCE CHECKS									
	100HRS/ Annual inspection	LIMITATION	100 H	CZ.CAO.0013				1027,9 H	1127,9 H	100 H	Perform 100HRS/Annual inspection per AMM 761-876
			365 D	LKHK			15.10.2025	15.10.2026	244 D		
			-	052-25			-	-	-		
	50 HRS inspection	LIMITATION/ INSPECTION	50	CZ.CAO.0013				1027,9 H	1077,9 H	50 H	Perform 50HRS inspection per AMM 761-876
			365 D	LKHK			15.10.2025	15.10.2026	244 D		
	/First 50 HRS - Injector nozzles inspection./		-	052-25			-	-	-		
AMM CHAPTER 05-30 - Per Flight Hour		TIME LIMITS / MAINTENANCE CHECKS									
	Pilot's Side Cockpit Window/Storm Window Inspection	INSPECTION	50	Piper				0,0 H	N/A by Equipment		AMM 05-30
			-	KVRB			09.05.2012				
			-	4636539			0				
	Lycoming SB 521 & 531	INSPECTION	250 H	CZ.CAO.0013				1027,9 H	1277,9 H	250 H	AMM 05-30
			365 D	LKHK			15.10.2025	15.10.2026	244 D		
			-	052-25			-	-	-		
	Piper SB No. 1204 dated December 18, 2009	INSPECTION	250 H	CZ.CAO.0013				1027,9 H	1277,9 H	250 H	AMM 05-30
			365 D	LKHK			15.10.2025	15.10.2026	244 D		
			-	052-25			-	-	-		
	Battery capacity test for equipped with Gill G-243 or G-250S battery	INSPECTION	400	Piper				0,0 H	Gill battery is not installed.		Applicable only for Gill batteries AMM 24-30-00
			330	KVRB			09.05.2012				
			-	4636539			0				
	Main Aircraft Battery [first]	CAPACITY TEST [first]	-	Piper				0,0 H	-	-	For new batteries only, perform a capacity check (see 24-30-00, Capacity Test) after the first twelve (12) months.
	S/N:.....		365 D	KVRB			09.05.2012	09.05.2013	-		
	P/N: 601-910 (Concorde RG-41)		-	4636539			0	-	-		
	Main Aircraft Battery	CAPACITY TEST (85%-90%)	-	Piper				1189,6 H	-	-	Batteries operatinf less than 1000 FH per year. If battery capacity is less than 85%, remove battery form service.
	S/N:.....		180 D	KVRB			12.05.2021	08.11.2021	-		
	P/N: 601-910 (Concorde RG-41)		-	4636539			0	-	-		
	Main Aircraft Battery [thereafter]	CAPACITY TEST	-	CZ.CAO.0013				1027,9 H	-	-	Capacity above 90% perform a capacity check each twelve (12) months. If capacity less than 85% remove battery from service.
	S/N: 41032656		365 D	LKHK			15.10.2025	15.10.2026	244 D		
	P/N: RG24-17		-	052-25			-	-	-		
	Valve rockers - CHECK	INSPECTION	400 H	CZ.145.0059				780,7 H	1180,7 H	153 H	AMM 05-30
	Rocker box		-	LKHK				05.10.2022	-	-	
			-	-				0	-	-	

	Vacuum system inlet air filter	REPLACE	500 H 365 D				-	-	-	AMM 05-30 each 500 hours time-in-service, annually, or at vacuum pump replacement, whichever comes first.
	Engine Air filter replace	REPLACE	500 H - -	CZ.145.0059 LKHK -			943,1 H 01.10.2024 N/A	1443,1 H - -	415 H - -	AMM 05-30
	Drain wing fuel tanks	INSPECTION	500 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1527,9 H - -	500 H - -	AMM 05-30
	Check fuel tank sealing material	INSPECTION	500 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1527,9 H - -	500 H - -	AMM 05-30
	Check fuel transmitters and electrical connectors for cleanliness, condition, and security.	INSPECTION	500 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1527,9 H - -	500 H - -	AMM 05-30
	Check that fuel transmitter floats (mounted on forward access panels #2 and #5 from the wing tip) are secure and that fuel strainers are secure and unobstructed.	INSPECTION	500 H 730 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1527,9 H 15.10.2027 -	500 H 609 D -	AMM 05-30. Every 2 years or after 500 Hour, whichever occurs first.
	Remove propeller; remove sludge from crankshaft. Clean any residual sludge clinging to the exterior of propeller / crankshaft mating surfaces.	INSPECTION	500 H - -	CZ.145.0059 LKHK -			780,7 H 05.10.2022 0	1280,7 H - -	253 H - -	AMM 05-30
	L/H Slick Magneto(s) P/N:6363 S/N 16020502	INSPECTION/ CLEAN	500 H - -	CZ.145.0059 LKHK -			997,4 H 11.07.2025 0	1497,4 H - -	470 H - -	Inspect and clean magneto(s) per 500 Hour Inspection in the Slick F1100 Master Service Manual.
	R/H Slick Magneto(s) P/N:6360 S/N 16030208	INSPECTION/ CLEAN	500 H - -	CZ.145.0059 LKHK -			997,4 H 11.07.2025 0	1497,4 H - -	470 H - -	Inspect and clean magneto(s) per 500 Hour Inspection in the Slick F1100 Master Service Manual.
	Coin-tap erosion shield on composite blades.	INSPECTION	500 H - -	CZ.145.0059 LKHK -			1004,4 H 28.07.2025 0	1504,4 H - -	477 H - -	See latest revision Hartzell Composite Blade Manual No. 135
	Garmin G1000/ G1000 NXi Integrated Avionics System (IAS) - GARMIN	INSPECTION	500 H - -	CZ.145.0059 LKHK -			979,0 H 05.06.2025 0	1479,0 H - -	451 H - -	Insp. as specified in 34-25-01 (G1000) or 34-25-02 (G1000 NXi), Integrated Avionics System (IAS) - Garmin, Insp.
	Inspect cabin pressurization system operation. See 21-30-00, Pressurization System Test.	INSPECTION	550 H - -	CZ.145.0059 LKHK -			500,0 19.03.2020 N/A	1050,0 H - -	22 H -	AMM 21-30-00
	Vacuum pump(s) model AA441CC/AA442CW - replace series without Wear Indicator Ports Upper S/N	REPLACE	600 H - -	CZ.145.0059 LKHK -			943,1 H 01.10.2024 N/A	1543,1 H - -	515 H - -	For airplanes equipped with Aero Accessories, Inc. vacuum pump(s) model AA441CC /AA442CW series without Wear Indicator Ports. AMM 05-30
	Vacuum pump(s) model AA441CC/AA442CW - replace series without Wear Indicator Ports Lower S/N 1KM707	REPLACE	600 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1627,9 H - -	600 H - -	For airplanes equipped with Aero Accessories, Inc. vacuum pump(s) model AA441CC /AA442CW series without Wear Indicator Ports. AMM 05-31
	GFC 700 autopilot - visual inspection and clean and apply grease to output gear of the GSA 8X Servo Actuator.	INSPECTION (First 1000Hrs or first 3 years)	1000 H 1095 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- - -	- - -	First 1000 Hrs or first 3 years (AMM 22-10-00)
	Replace engine compartment flexible fuel and oil hoses as required; except for TSO-C53a - Type D hoses which are replaced on-condition.	REPLACE	1000 H 2920 D or engine OVH	CZ.145.0059 LKHK -			943,1 H 01.10.2024 N/A	1943,1 H 29.09.2032 -	915 H 2420 D -	AMM 05-30
	Nose gear hydraulic hoses (gear actuator/door actuator/sequence valve).	REPLACE	1000 H 2920 D -	CZ.145.0059 LKHK -			943,1 H 01.10.2024 N/A	1943,1 H 29.09.2032 -	915 H 2420 D -	AMM 05-30
	Coin-tap the entire blade on composite blades.	INSPECTION	1000 H - -	CZ.145.0059 LKHK -			1004,4 H 28.07.2025 0	2004,4 H - -	977 H - -	See latest revision Hartzell Composite Blade Manual No. 135
	Inspect condition of bolts used with flap rollers and aileron hinges.	INSPECTION	1000 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	2027,9 H - -	1000 H - -	AMM 05-30 (Replace as required)
	Inspect flap tracks for security of attachment, damage, condition, and corrosion.	INSPECTION	1000 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	2027,9 H - -	1000 H - -	AMM 05-30
	Remove SpeedBrake cartridges and return to Precise Flight Inc. for clutch lubrication and spring replacement.	INSPECTION	1000 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	1000,0 H - -	EXPIRED - -	W/O: 052-25 system inhibited
	Garmin G1000/ G1000 NXi Integrated Avionics System (GARMIN)	INSPECTION	1000 H - -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	2027,9 H - -	1000 H - -	AMM 05-30. Inspection as specified in 34-25-01 (G1000) or 34-25-02 (G1000 NXi), IAS, Insp.

	Aircraft structure - DETAIL INSPECTION	INSPECTION	2000 H 2555 D -	CZ.145.0059 LKHK -			884,3 H 22.08.2023 0	2884,3 H 20.08.2030 -	1856 H 1649 D -	AMM 05-30, Remove SpeedBrake cartridges and return to Precise Flight Inc. for clutch lubrication and spring replacement.
	Engine overhaul Model: T10-540-AE2A S/N: L-14278-61A	OVERHAUL OR REPLACE	2000 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	2000,0 H -	972 H -	Each 2000 Hrs or as specified Lycoming Service instructions No.1009
	Alternator #1 P/N: ALU-6539-4 S/N H-X051420	OVERHAUL OR REPLACE	2000 H 4380 D or engine OVH	CZ.145.0059 LKHK -			943,1 H 01.10.2024 N/A	2943,1 H 28.09.2036 -	1915 H 3880 D -	AMM 05-30, Each 2,000 Hours or Twelve (12) Years, or at engine overhaul, whichever comes first, overhaul or replace alternators.
	Alternator #2 P/N: ALU-6539-3 S/N H-P111194	OVERHAUL OR REPLACE	2000 H 4380 D or engine OVH	Piper KVRB 4636698			0,0 H 26.08.2016 0	2000,0 H 23.08.2028 -	972 H 922 D -	AMM 05-30, Each 2,000 Hours or Twelve (12) Years, or at engine overhaul, whichever comes first, overhaul or replace alternators.
	Aspen Avionics EBD - Internal back-up battery P/N: 409-00003-002 S/N: 251900035	REPLACE	2200 H 1095 D -	CZ.145.0059 LKHK -			1025,8 H 08.09.2025 0	3225,8 H 07.09.2028 -	2198 H 937 D -	For airplanes equipped with Aspen Avionics EBD
	Propeller governors overhaul	OVERHAUL OR REPLACE	2400 H - or engine OVH	Piper KVRB 4636698			0,0 H 26.08.2016 0	2400,0 H -	1372 H -	Hartzell Service Letter No. 61.
	Propeller overhaul or replace Model: HC-J3Y1R-1N, S/N: NY287B	OVERHAUL OR REPLACE	2400 H 2190 D -	CZ.145.0059 LKHK -			780,7 H 05.10.2022 0	3180,7 H 03.10.2028 -	2153 H 963 D -	Hartzell Service Letter No. 61.
	Sky Tec Starter	OVERHAUL	2700 H - or engine OVH	CZ.145.0059 LKHK -			532,0 H 05.08.2020 0	3232,0 H -	2204 H -	AMM 05-30
	Inspect the COMM 1 (lower) Antenna - PA-46-350P S/N: 4636375 thru 4636462 (less 4636460)	INSPECTION	4000 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	N/A by AC S/N		AMM 23-10-00, In PA-46-350P S/N's 4636375 thru 4636462 (less 4636460)
	SpeedBrake cartridges	REPLACE	5000 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	5000,0 H -	3972 H -	"Return to Precise Flight Inc. for drive assembly replacement.
	Engine mount bolts located at the firewall (F.S. 79.00).	REPLACE	7500 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	7500,0 H -	6472 H -	AMM 05-30
	Inspect the COMM 2 (upper) Antenna - PA-46-350P S/N: 4636375 thru 4636462 (less 4636460)	INSPECTION	9400 H - -	Piper KVRB 4636698			0,0 H 26.08.2016 0	N/A by AC S/N		AMM 05-30 In PA-46-350P S/N's 4636375 thru 4636462, less 4636460
AMM CHAPTER 05-30 Per Calendar Year										
	30 days inspection	INSPECTION	- 30 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 14.11.2025 -	- EXPIRED -	AMM 05-30, STBY AI EPS, Extinguisher, Oxygen inst.
	90 days inspection	INSPECTION	- 90 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 15.01.2026 -	- EXPIRED -	AMM 05-30, Fuel filter, Stanby attitude indicator 34-20-00, ELT
	4 month inspection Engine oil and full-flow cartridge oil filter P/N: AA48103-2, Oil Phillip 20W50 VICTORY	FUNCTIONAL TEST/ REPLACEMENT	50 H 120 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	1077,90 H 12.02.2026 -	50,00 H EXPIRED -	AMM 05-30
	6 month inspection - Propeller lubrication If annual usage is significantly less than 100 Hrs	INSPECTION	- 180 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 13.04.2026 -	- 59 D -	See Hartzell Standard Practices Manual No. 202 latest revision.
	11 Months Inspection - Battery - CAPACITY TEST for equipped with Gill G-243 or G-250S battery	CAPACITY TEST	- 330 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	Gill battery is not installed.		For airplanes equipped with Gill G-243 or G-250S battery
	SpeedBrake Annual inspection	INSPECTION	- 365 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 15.10.2026 -	- 244 D -	AMM 27-60-00
	Airborne 1H5 and 1H24 series check valve manifolds inspection [first]	INSPECTION	- 1825 D -	Piper KVRB 4636698			0,0 H 26.08.2016 0	- 25.08.2021 -	- - -	Airborne SL 39A..
	Airborne 1H5 and 1H24 series check valve manifolds inspection [thereafter]	INSPECTION	- 365 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 15.10.2026 -	- 244 D -	Airborne SL 39A..
	STBY Attitude battery capacity test In PA-46-350P S/N: 4636375 - 4636651, less 4636633 and all PA-46R-350T	CAPACITY TEST	- 365 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A by AC S/N		See Standby Attitude Indicator . AMM 34-20-00
	Aspen Avionics EBD Insp. Under Aspen Avionics Evolution Backup Display (EBD)	INSPECTION	- 365 D -	CZ.145.0059 LKHK -			1025,8 H 08.09.2025 0	- 08.09.2026 -	- 207 D -	EBD in 34-24-00, per the annual insp.

	Lubricate per annual requirements of Lubrication Chart in 12-20-00	LUBRICATE	- 365 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 15.10.2026 -	- 244 D -	Lubrication Chart in 12-20-00
	If a rechargeable (gauged) fire extinguisher installed <i>Annual maintenance per Gauged, Class 2B:C P/N: RT-A344T, S/N: H-32967547</i>	INSPECTION	- 365 D -	CZ.CAO.0013 LKHK 052-25			1027,9 H 15.10.2025 -	- 31.12.2025 -	- EXPIRED -	Perform annual maintenance per Guged, Class 2B:C Fire Extinguisher Model No. A344T in 26-20-00
	Test and inspect the static pressure system and altimeters. (Garmin G1000 or G1000 Nxi)	INSPECTION	- 730 D -	CZ.145.0059 LKHK -			904,3 H 26.04.2024 0	- 26.04.2026 -	- 72 D -	AMM if Garmin G1000 or G1000 Nxi is installed, see 34-25-01 (G1000) or 35-25-02 (G1000 Nxi)
	Test and inspect the transponder.	INSPECTION	- 730 D -	CZ.145.0059 LKHK -			904,3 H 26.04.2024 0	- 26.04.2026 -	- 72 D -	EASA SIB 2011-15
	Magnetic compass - SWING	INSPECTION	- 730 D -	CZ.145.0059 LKHK -			979,0 H 05.06.2025 N/A	- 05.06.2027 -	- 477 D -	See GRS/GMU Calibration Procedures under LRU Test Procedures in 34-25-01 (G1000) or 34-25-02 (G1000 Nxi)
	Magnetometer (Avidyne Entegra) - CALIBRATION	RECALIBRATE	- 730 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A by Equipment		See Magnetic Heading Systems in 34-20-00
	Magnetometer - CALIBRATION	RECALIBRATE	- 730 D -	CZ.145.0059 LKHK -			904,3 26.04.2024 N/A	- 26.04.2026 -	- 72 D -	See Magnetic Heading Systems in 34-20-00
	Aspen Avionic EBD per the twenty-four (24) month insp.	INSPECTION	- 730 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A by Equipment		EBD in 34-24-00, per the 24month insp.
	GAE 43 - Calibration Calibration under Integrated Avionics System (IAS)	CALIBRATION	- 730 D -	CZ.145.0059 LKHK -			904,3 26.04.2024 N/A	- 26.04.2026 -	- 72 D -	Calibration under IAS - LRU Test Procedures, for G1000 see 34-25-01 or for G1000 Nxi see 34-25-02
	STBY Attitude Indicator battery replace	REPLACE	- 1095 D -	MAC Muncie CRS# AJVR135C			1189,6 H 03.05.2021 0	- 02.05.2024 -	- - -	See Standby Indicator in 34-20-00 (in all PA-46R-350T an in PA-46-350P SN 4636460, 4636463-4636632 and
	Fixed oxygen system masks In PA-46R-350T only	OVERHAUL OR REPLACE	- 1825 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A only for PA-46R-350T		See 35-20-00
	Oxygen cylinder - HYDROSTATICALLY TEST In PA-46R-350T only	INSPECTION	- 1825 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A only for PA-46R-350T		AMM 05-30, every 5 years or if marked with a five-pointed star, every 10 years
	The regulator - overhaul Replacement of the fill valve is recommended, but not	OVERHAUL /and REPLACE/	- 1825 D -	Piper KVRB 4636539			0,0 H 09.05.2012 0	N/A only for PA-46R-350T		AMM 05-30
	Attach fittings and push rods /Repair or replace as required./	INSPECTION	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	Inspect the Attach Fittings and Push Rods. Repair or replace as required and, when finished, reapply Dinitrol AV8 Corrosion Inhibiting Compound (P/N 89500-800).
	Fwd and aft wing spar to fuselage attach fittings.	INSPECTION	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	(See Attach Fittings Corrosion Control, 57-40-00)
	Fwd vertical fin attach fittings. -	INSPECTION	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	(See Attach Fittings Corrosion Control, 55-30-00)
	Elevator trim tab push rods.	INSPECTION	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	(See Elevator Trim Tab Push Rod Corrosion Control, 55-20-00)
	Fwd and aft horizontal stabilizer attach fittings.	INSPECTION	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	(See Attach Fittings Corrosion Control, 55-10-00)
	CO Pulse Oximeter/Detector S/N: 14733 P/N: 686-244 (455-101-001)	RETURNED for REPLACEMENT	- 1825 D -	CZ.145.0059 LKHK -			665,3 H 26.08.2021 0	- 25.08.2026 -	- 193 D -	AMM 05-30 (In PA-46-350P S/N: 4636633, 4636652 and up)
	Update the GRS "Earth magnetic field model" (Garmin G1000 or G1000 Nxi)	UPDATE	- 1825 D -	CZ.145.0059 LKHK -			642,1 30.07.2021 N/A	- 29.07.2026 -	- 166 D -	Is available from Garmin on July 1st of each fifth year - i.e, 2020, 2025, etc.
	Inc. vacuum pump(s) shear coupling replacement	REPLACE	- 2190 D -	CZ.145.0059 LKHK -			780,7 H 05.10.2022 0	- 03.10.2028 -	- 963 D -	AMM 05-30
	Fire extinguisher (gauged) Completely discharge the rechargeable (gauged) and have it inspected and recharged.	INSPECTION/ RECHARGED	- 2190 D -	CZ.145.0059 LKHK -			884,3 H 22.08.2023 0	- 20.08.2029 -	- 1284 D -	If installed, completely discharge the rechargeable (

	Fuselage and Wing fluid Hoses to system pressure [first]	INSPECTION	- 3650 D	Piper KVRB 4636698				0.0 H 26.08.2016 0	- 24.08.2026 -	- 192 D -	AMM 05-30
	Fuselage and Wing fluid Hoses [thereafter]	INSPECTION	- 1825 D	Piper KVRB 4636539				0.0 H 09.05.2012 0	- 02.06.2027 -	- - -	If OK, recheck each 5 years (max. 20 years total time in service)
	Repl. CMOS battery in the multifunction display (MFD) (For airplanes equipped with Avidyne Entegra)	REPLACE	- 3650 D	Piper KVRB 4636539				0.0 H 09.05.2012 0	N/A by Equipment		See Multifunction Display in 34-22-00
	Airborne 1H5 and 1H24 series check valves replace 1H5-18 S/N: 2203214 1H24-18: S/N: 0354-33	REPLACE	- 3650 D	Piper KVRB 4636698				0.0 H 26.08.2016 0	- 24.08.2026 -	- 192 D -	Airborne SL 39A.
	Oxygen cylinder - HYDROSTATICALLY TEST <i>In PA-46R-350T only</i> <i>"marked with a five-pointed star"</i>	HYDROSTATIC TEST	- 3650 D	Piper KVRB 4636539				0.0 H 09.05.2012 0	N/A only for PA-46R-350T "only"		(ICC or DOT "3AA" marked with a five-pointed star
	Fixed Oxygen Generators - REPLACEMENT S/N's : A21081399 A21081403 A21081397	REPLACE	- 3650 D	Piper KVRB 4636698				0.0 H 26.08.2016 0	- 24.08.2026 -	- 192 D -	AMM 05-30, NOTE: 10 years from date of manufacture as indicated on the unit data plate. (In PA-46-350P only)
	Fire extinguishers - REPLACEMENT	REPLACE	-	Piper				0.0 H 09.05.2012 0	N/A by Equipment		AMM 05-30 (12 years from date of manufacture)
	Fire extinguishers - REPLACEMENT Hydrostatically test rechargeable (gauded)	HYDROSTATICALLY TEST	- 3650 D	Piper KVRB 4636698				0.0 H 26.08.2016 0	- 31.12.2025 -	- EXPIRED -	AMM 05-30
	Oxygen cylinder replace DOT-SP-10945 from MFD <i>In PA-46R-350T only</i> 102641-145	REPLACE	- 5475 D	Piper KVRB 4636539				0.0 H 09.05.2012 0	N/A only for PA-46R-350T "only"		AMM 05-30
	Fluid hose may exceed twenty (20) years total time-in- service.	REPLACE	- 7300 D	Piper KVRB 4636698				0.0 H 26.08.2016 0	- 21.08.2036 -	- 3842 D -	AMM 05-30
COMPLIED ACC. TO	AIRCRAFT MAINTENANCE MANUAL NO.:	Doc. 761-876, Rev. PR250314, 11-MAR-2025				Checked by:					
	PROPELLER MANUAL NO.:	Doc. 145, REV 25, APR 2025									
	ENGINE MAINTENANCE MANUAL NO.:	Doc. LYCOMING 60297-27, Rev. L, Nov-2013									
	MAINTENANCE PROGRAM NO.:	MP-PA46-350P-OKSTN-03									
							13.02.2026	date	stamp	signature	